

# Sydney Opera House (SOH) – Attended Construction Noise Measurements – 3rd March 2021

Sydney Opera House Bennelong Point

Report Reference:

20164 Sydney Opera House - Attended Construction Noise Measurements - 2021-03-03 - Revision

4 March 2021

Project Number: 20164

Version: Revision 1

# Sydney Opera House (SOH) – Attended Construction Noise Measurements – 3rd March 2021

#### PREPARED BY:

Pulse Acoustic Consultancy Pty Ltd ABN 61 614 634 525 Level 5, 73 Walker Street, North Sydney, 2060

This report has been prepared by Pulse Acoustic Consultancy Pty Ltd with all reasonable skill, care and diligence, and taking account of the timescale and resources allocated to it by agreement with the Client. Information reported herein is based on the interpretation of data collected, which has been accepted in good faith as being accurate and valid.

This report is for the exclusive use of Sydney Opera House
No warranties or guarantees are expressed or should be inferred by any third parties.

This report may not be relied upon by other parties without written consent from Pulse Acoustic.

Pulse Acoustic disclaims any responsibility to the Client and others in respect of any matters outside the agreed scope of the work.

#### DOCUMENT CONTROL

Reference	Status	Date	Prepared	Checked	Authorised
20164 Sydney Opera House – Attended Construction Noise Measurements – 2021-03-03 - Revision 1	Final	4 <sup>th</sup> March 2021	Douglass Harrison	Alex Danon	Matthew Harrison

# **TABLE OF CONTENTS**

1	INTRO	DDUCTION4
2	SITE	DESCRIPTION5
3	CONS	STRUCTION NOISE OBJECTIVES7
		Sydney Opera House Building Renewal Noise Impact Assessment for DA3 – SSD 8663 – Arup Pty Ltd dated 15 <sup>th</sup> May 2018
	3.2	Construction Noise and Vibration Management Sub Plan – Hibbs and Associates Pty Ltd dated 11 <sup>th</sup> February 20208
4	MEAS	SURED CONSTRUCTION NOISE LEVELS9
	4.1	Attended Measurement Equipment9
	4.2	Measured Results9
5	CONC	CLUSION20
APPE	NDIX A	A: ACOUSTIC TERMINOLOGY21
TABL Table		Measured Attended Construction Noise Levels
FIGU	RES	
Figure Figure		Site Description and Measurement Location – Sourced from SixMaps NSW5 Attended Construction Noise Measurement Location – Bennelong Apartments



#### 1 INTRODUCTION

Pulse Acoustic Consultancy Pty Ltd (Pulse Acoustics) has been engaged by Sydney Opera House (SOH) to undertake attended noise measurements during construction works on Wednesday 3<sup>rd</sup> March 2021.

This report documents noise measurements from the concrete truck movements and concrete pour activities on Wednesday 3<sup>rd</sup> March 2021. Specifically, attended construction noise measurements have been undertaken to quantify any noise impacts during a concrete pour within the Sydney Opera House at the nearest potentially affected receiver, the Bennelong Apartments located along Macquarie Street.

Attended noise measurements as detailed below, were undertaken along the northern facade of the Bennelong Apartments and southern Sydney Opera House forecourt interface as shown in Figure 1 and Figure 2.

Construction noise levels from a concrete pour were measured between 6:30am and 11:15am on Wednesday 3<sup>rd</sup> March 2021 by this office.

Construction Noise Management Levels (NMLs) have previously been established by Arup Pty Ltd in the *Noise Impact Assessment for DA3 – SSD 8663*, dated 15<sup>th</sup> May 2018 on behalf of the Sydney Opera House and Hibbs & Associates Pty Ltd in the *Construction Noise and Vibration Management Sub Plan*, dated 11<sup>th</sup> February 2020 on behalf of Taylor Group Pty Ltd (i.e. Managing Contractor).

A list of acoustic terminology used in this report is included in Appendix A of this report.



#### 2 SITE DESCRIPTION

The Sydney Opera House is located on the Bennelong Point Peninsula in Sydney Harbour. Located to the south west of the site is Sydney's major passenger ferry terminal known as Circular Quay, with ferry movements every few minutes. Located to the west of the site is the Harbour Bridge which carries an annual average daily traffic volume of 150,000+ vehicles. Located to the north across the harbour is existing single and multi-storey residential dwellings including Admiralty and Kirribilli House. Mrs Macquarie's chair, Sydney Royal Botanic Gardens, Government House, and its associated gardens wrap around from the east to the south east of the site. Finally, the Bennelong Apartments located along Macquarie Street is located immediately south of the Sydney Opera House with these being the nearest potentially most affected receiver, as shown in Figure 1 below.

Figure 1 Site Description and Measurement Location – Sourced from SixMaps NSW

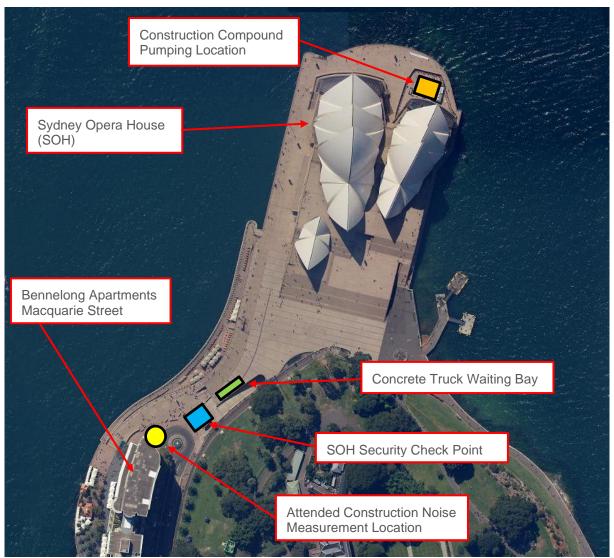




Figure 2 Attended Construction Noise Measurement Location – Bennelong Apartments







Note: Site photos are from a previous onsite attendance. All locations shown above are identical to the measurements outlined below.



#### 3 CONSTRUCTION NOISE OBJECTIVES

As mentioned above, construction noise management levels have previously been determined by Arup Pty Ltd and Hibbs and Associates Pty Ltd in both the *Noise Impact Assessment* (Arup Pty Ltd) and *Construction Noise Vibration Management Sub Plan* (Hibbs and Associates Pty Ltd). As such, the construction noise objectives as established in these reports are reproduced below.

### 3.1 Sydney Opera House Building Renewal Noise Impact Assessment for DA3 – SSD 8663 – Arup Pty Ltd dated 15<sup>th</sup> May 2018

Section 2.1 of the Arup *Noise Impact Assessment* (report reference 2018-05-15 NOISE IMPACT ASSESSMENT (DA3)\_ISSUE (REV A), dated 15<sup>th</sup> May 2018) outlines the following construction noise limits.

#### 2.1 Construction Noise

Most of the construction works for the project are internal and will take place in spaces that are extremely well insulated against noise transfer. External work at night will be limited to *occasional* deliveries where these cannot be safely undertaken during normal working hours or because of large loads.

Calculations show that construction noise levels should not exceed the appropriate criteria at any time.

Notwithstanding the above, the Sydney Opera House (SOH) has recognised noise issues affecting nearby neighbours during external construction works in the past. Therefore the Sydney Opera House intends that contractors who are undertaking noisy external works identify mitigation measures for this work in their Construction Noise Management Plan (CNMP) which they will be required to prepare before work starts on site. This CNMP will be reviewed by the SOH and their noise consultants prior to approval and implementation on site.

The Contract with the Managing Contractor will include a clause allowing SOH to disallow any equipment that it considers to be excessively noisy. Similarly the Managing Contractor may include incentives, as it sees fit, for sub-contractors who can provide noise mitigation measures as part of their contract works.

The following noise limits will be applied:

Receiver	Time Period <sup>1</sup>	Warning level, L <sub>Aeq(15min)</sub>	Maximum Level, LAeq(15min)
Bennelong	Day (standard hours )	65 dB	68 dB
Apartments	Day (outside hours)	60 dB	63 dB
	Evening	59 dB	62 dB
	Night	50 dB	53 dB
Kirribilli	Day (standard hours)	61 dB	64 dB
	Day (outside hours)	56 dB	59 dB
	Evening	54 dB	57 dB
	Night	48 dB	51 dB
Potts Point	Day (standard hours)	58 dB	61 dB
	Day (outside hours)	53 dB	56 dB
	Evening	53 dB	56 dB
	Night	47 dB	50 dB

Should complaints be received, attended acoustic monitoring will be undertaken to ascertain the 'noisier' work activities and address specific work practices and locations to better alleviate noise complaints from that particular activity.

Following identification that all noise levels have returned to being consistently below the above maximum levels the monitoring will revert to remote monitoring.

Nearby residents will be provided with a notice that informs them of the nature of the works, the duration and the extent of works being undertaken. 24hr contact details will be provided to allow complaints to be logged and addressed as soon as possible by the Opera House.



## 3.2 Construction Noise and Vibration Management Sub Plan – Hibbs and Associates Pty Ltd dated 11<sup>th</sup> February 2020

Section 2.3 of the Hibbs and Associates *Construction Noise and Vibration Management Sub Plan* (report reference *S11163-R01-CNVMSP-A1*, dated 11<sup>th</sup> February 2020) outlines the following construction noise limits.

#### 2.3 Noise Management Levels

SOH's Noise Impact Assessment (NIA) <sup>3</sup> conducted noise surveys at the nearest NSRs and calculated NMLs from these in accordance with the ICNG. The Construction Management Plan sets out work patterns as:

- 1030 hours to 1800 hours General construction/no major noise generating activities
- 1800 hours to 2330 hours Planning and quiet activities which are compatible with the live performances occurring in other venues within the site
- 2330 hours to 1030 hours Works which will otherwise be disruptive to Opera House operations but not audible outside of the building

Based on this, only the NMLs for standard daytime working hours apply.

**Table 2.1: Project Noise Management Levels** 

PASR	Kirribilli	Bennelong Apartments	Potts Point
Warning level, L <sub>Aeq,15m</sub> (dB)	61	65	58
Maximum Level, $L_{Aeq,15m}$ (dB)	64	68	61



#### 4 MEASURED CONSTRUCTION NOISE LEVELS

#### 4.1 Attended Measurement Equipment

The attended noise measurements were conducted using a Brüel & Kjær Type 2270 sound level meter (serial number 2679267). Calibration of the sound level meter was checked prior to and following the measurements using a Brüel & Kjær Type 4231 sound calibrator (serial number 3009148). The calibrator emitted a calibration tone of 94 dB at 1 kHz. The drift in calibration did not exceed ±0.5 dB. All equipment carries appropriate and current NATA (or manufacturer) calibration certificates.

Attended noise measurements were undertaken on Wednesday 3<sup>rd</sup> March 2021 between 6:30am and 11:15am.

#### 4.2 Measured Results

Results of the attended noise measurements are outlined in Table 1. The results show that the noise contribution from the construction works was below both the warning and maximum criteria during all measurements.



Table 1 Measured Attended Construction Noise Levels

Date and Time	Measured Noi	se Level dBA		Observations during survey interval
	LAeq (15-minutes)	LA10 (15-minutes)	LA90 (15-minutes)	
6:30am to 6:45am	63	66	58	<ul> <li>Heavy vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Street sweeping</li> </ul>
6:45am to 7:00am	60	62	54	<ul> <li>Heavy vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Street sweeping</li> <li>Two truck movements around Macquarie Street roundabout</li> <li>One truck enters Sydney Opera House</li> </ul>



Date and Time	Measured Noi	se Level dBA		Observations during survey interval
	LAeq (15-minutes)	LA10 (15-minutes)	LA90 (15-minutes)	
7:00am to 7:15am	59	61	54	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Distant sound of street sweeper</li> <li>One truck movement around Macquarie Street roundabout</li> <li>One truck leave Sydney Opera House</li> </ul>
7:15am to 7:30am	60	62	55	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Loud talking</li> <li>One truck movement on Macquarie Street roundabout</li> <li>One truck enters Sydney Opera House</li> </ul>



Date and Time	Measured Noi	se Level dBA		Observations during survey interval
	LAeq (15-minutes)	LA10 (15-minutes)	LA90 (15-minutes)	
7:30am to 7:45am	60	63	57	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Two trucks enter Sydney Opera House</li> <li>Distant leaf-blower in Botanic Gardens</li> </ul>
7:45am to 8:00am	66	71	57	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>One truck movement on Macquarie Street roundabout</li> <li>One truck leaving Sydney Opera House</li> <li>Distant leaf-blower in Botanic Gardens</li> </ul>
				Note: Measurement heavily affected by leaf blower noise. No concrete trucks were on site during this period.



Date and Time	Measured Noi	se Level dBA		Observations during survey interval
	LAeq (15-minutes)	LA10 (15-minutes)	LA90 (15-minutes)	
8:00am to 8:15am	60	62	55	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Two truck movements on Macquarie Street roundabout</li> <li>One truck enters Sydney Opera House</li> <li>Car honk that came from Macquarie Street roundabout</li> </ul>
8:15am to 8:30am	60	63	55	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>One slurry and one concrete truck (#1) enter construction site</li> <li>One truck enters Sydney Opera House</li> <li>Distant laughing</li> </ul>



Date and Time	Measured Noi	se Level dBA		Observations during survey interval
	LAeq (15-minutes)	LA10 (15-minutes)	LA90 (15-minutes)	
8:30am to 8:45am	60	62	55	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Two trucks leave Sydney Opera House</li> <li>Two trucks enter Sydney Opera House</li> <li>Slurry truck leaves construction site</li> <li>One truck movement on Macquarie Street roundabout</li> </ul>
8:45am to 9:00am	61	62	55	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>One truck movement on Macquarie Street roundabout</li> <li>One truck leaves Sydney Opera House</li> <li>Car honk that came from Macquarie Street roundabout</li> <li>Loud talking</li> <li>Leaf-blowing outside of UGG Store</li> </ul>



Date and Time	Measured Noi	se Level dBA		Observations during survey interval
	LAeq (15-minutes)	LA10 (15-minutes)	LA90 (15-minutes)	
9:00am to 9:15am	60	63	55	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Background music from The UGG Store</li> <li>Two truck movements on Macquarie Street roundabout</li> <li>Loud talking</li> <li>Distant leaf-blowing</li> </ul>
9:15am to 9:30am	58	60	55	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Background music from The UGG Store.</li> <li>One truck enters Sydney Opera House</li> </ul>



Date and Time	Measured Noi	se Level dBA		Observations during survey interval
	LAeq (15-minutes)	LA10 (15-minutes)	LA90 (15-minutes)	
9:30am to 9:45am	59	62	55	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Background music from The UGG Store.</li> <li>One truck enters Sydney Opera House</li> <li>One truck movement on Macquarie Street roundabout</li> <li>Talking next to measurement microphone</li> </ul>
9:45am to 10:00am	63	66	56	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Background music from The UGG Store</li> <li>Three trucks enter Sydney Opera House</li> <li>Two truck movements on Macquarie Street roundabout</li> <li>Two trucks leave Sydney Opera House</li> <li>Car honk that came from Macquarie Street roundabout</li> <li>Garbage truck idle on Macquarie Street</li> <li>Motorbike on Macquarie Street roundabout</li> <li>Loud talking</li> </ul>



Date and Time	Measured Noi	se Level dBA		Observations during survey interval
	LAeq (15-minutes)	LA10 (15-minutes)	LA90 (15-minutes)	
10:00am to 10:15am	61	63	55	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Background music from The UGG Store.</li> <li>Two truck movements on Macquarie Street roundabout</li> <li>Three trucks enter Sydney Opera House</li> <li>Garbage truck idle on Macquarie Street</li> <li>Motorbike on Macquarie Street roundabout</li> </ul>
10:15am to 10:30am	61	65	56	Vehicle movements Macquarie Street roundabout and Harbour Bridge.  Pedestrian movements along foreshore.  Marine Activity Circular Quay and Harbour.  Mobile crane located within construction compound.  Distant mechanical noise from Circular Quay.  Chirping of birds.  Background music from The UGG Store.  One concrete truck (#2) idle in holding bay  Two truck movements on Macquarie Street roundabout  Two trucks enter Sydney Opera House  Loud buggy on concourse  Helicopter flew overhead twice



Date and Time	Measured Noise Level dBA			Observations during survey interval
	LAeq (15-minutes)	LA10 (15-minutes)	LA90 (15-minutes)	
10:30am to 10:45am	60	63	55	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Background music from The UGG Store</li> <li>Concrete truck (#2) idle in holding bay</li> <li>Four trucks leave Sydney Opera House</li> <li>Concrete truck (#1) leaves construction site</li> <li>Three trucks enter Sydney Opera House</li> </ul>
10:45am to 11:00am	60	64	55	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Background music from The UGG Store.</li> <li>Three trucks leave Sydney Opera House</li> <li>Loud talking near measurement microphone</li> <li>Loud trolley wheeled nearby</li> <li>One bus movement on Macquarie Street roundabout</li> </ul>



Date and Time	Measured Noise Level dBA			Observations during survey interval
	LAeq (15-minutes)	LA10 (15-minutes)	LA90 (15-minutes)	
11:00am to 11:15am	61	65	55	<ul> <li>Vehicle movements Macquarie Street roundabout and Harbour Bridge.</li> <li>Pedestrian movements along foreshore.</li> <li>Marine Activity Circular Quay and Harbour.</li> <li>Mobile crane located within construction compound.</li> <li>Distant mechanical noise from Circular Quay.</li> <li>Chirping of birds.</li> <li>Background music from The UGG Store</li> <li>One bus movement on Macquarie Street roundabout</li> <li>One truck enters Sydney Opera House</li> <li>One truck leaves Sydney Opera House</li> <li>Loud talking near measurement microphone</li> <li>Loud trolley moves past measurement microphone twice</li> <li>Concrete truck (#2) leaves construction site – 11:14am</li> </ul>



#### **5 CONCLUSION**

Pulse Acoustic Consultancy Pty Ltd (Pulse Acoustics) has been engaged by Sydney Opera House (SOH) to undertake attended noise measurements during construction works on Wednesday 3<sup>rd</sup> March 2021.

In this document, attended construction noise measurements have been undertaken to quantify any noise impacts during the concrete pour within the Sydney Opera House at the nearest potentially affected receiver, the Bennelong Apartments located along Macquarie Street.

Measured construction noise levels at the Bennelong apartments northern façade have indicated compliance with the project NMLs (both warning and maximum levels).



#### APPENDIX A: ACOUSTIC TERMINOLOGY

Ambient The totally encompassing sound in a given situation at a given time, usually composed of sound

Sound from all sources near and far.

Audible Range The limits of frequency which are audible or heard as sound. The normal ear in young adults

detects sound having frequencies in the region 20 Hz to 20 kHz, although it is possible for

some people to detect frequencies outside these limits.

Character, T acoustic s

The total of the qualities making up the individuality of the noise. The pitch or shape of a

sound's frequency content (spectrum) dictate a sound's character.

Decibel [dB] The level of noise is measured objectively using a Sound Level Meter. The following are

examples of the decibel readings of every day sounds;

0dB the faintest sound we can hear

a quiet library or in a quiet location in the countrytypical office space. Ambience in the city at night

60dB Martin Place at lunch time

70dB the sound of a car passing on the street

80dB loud music played at home

90dB the sound of a truck passing on the street

100dB the sound of a rock band

115dB limit of sound permitted in industry

120dB deafening

dB(A) A-weighted decibels The ear is not as effective in hearing low frequency sounds as it is

hearing high frequency sounds. That is, low frequency sounds of the same dB level are not heard as loud as high frequency sounds. The sound level meter replicates the human response of the ear by using an electronic filter which is called the "A" filter. A sound level measured with this filter switched on is denoted as dB(A). Practically all noise is measured using the A filter. The sound pressure level in dB(A) gives a close indication of the subjective loudness of the

noise.

Frequency Frequency is synonymous to pitch. Sounds have a pitch which is peculiar to the nature of the

sound generator. For example, the sound of a tiny bell has a high pitch and the sound of a bass drum has a low pitch. Frequency or pitch can be measured on a scale in units of Hertz or

Hz.

Loudness A rise of 10 dB in sound level corresponds approximately to a doubling of subjective loudness.

That is, a sound of 85 dB is twice as loud as a sound of 75 dB which is twice as loud as a

sound of 65 dB and so on

LMax The maximum sound pressure level measured over a given period.

LMin The minimum sound pressure level measured over a given period.

L10 The sound pressure level that is exceeded for 10% of the time for which the given sound is

measured.

L90 The level of noise exceeded for 90% of the time. The bottom 10% of the sample is the L90 noise

level expressed in units of dB(A).

Leg The "equivalent noise level" is the summation of noise events and integrated over a selected

period of time.

Sound Pressure Level, LP dB A measurement obtained directly using a microphone and sound level meter. Sound pressure level varies with distance from a source and with changes to the measuring environment.

Sound pressure level equals 20 times the logarithm to the base 10 of the ratio of the rms sound

pressure to the reference sound pressure of 20 micro Pascals.